


three inches = one foot  
one and one half inches = one foot  
one inch = one foot  
one quarter inch = one foot  
three eighths inch = one foot  
one eighth inch = one foot

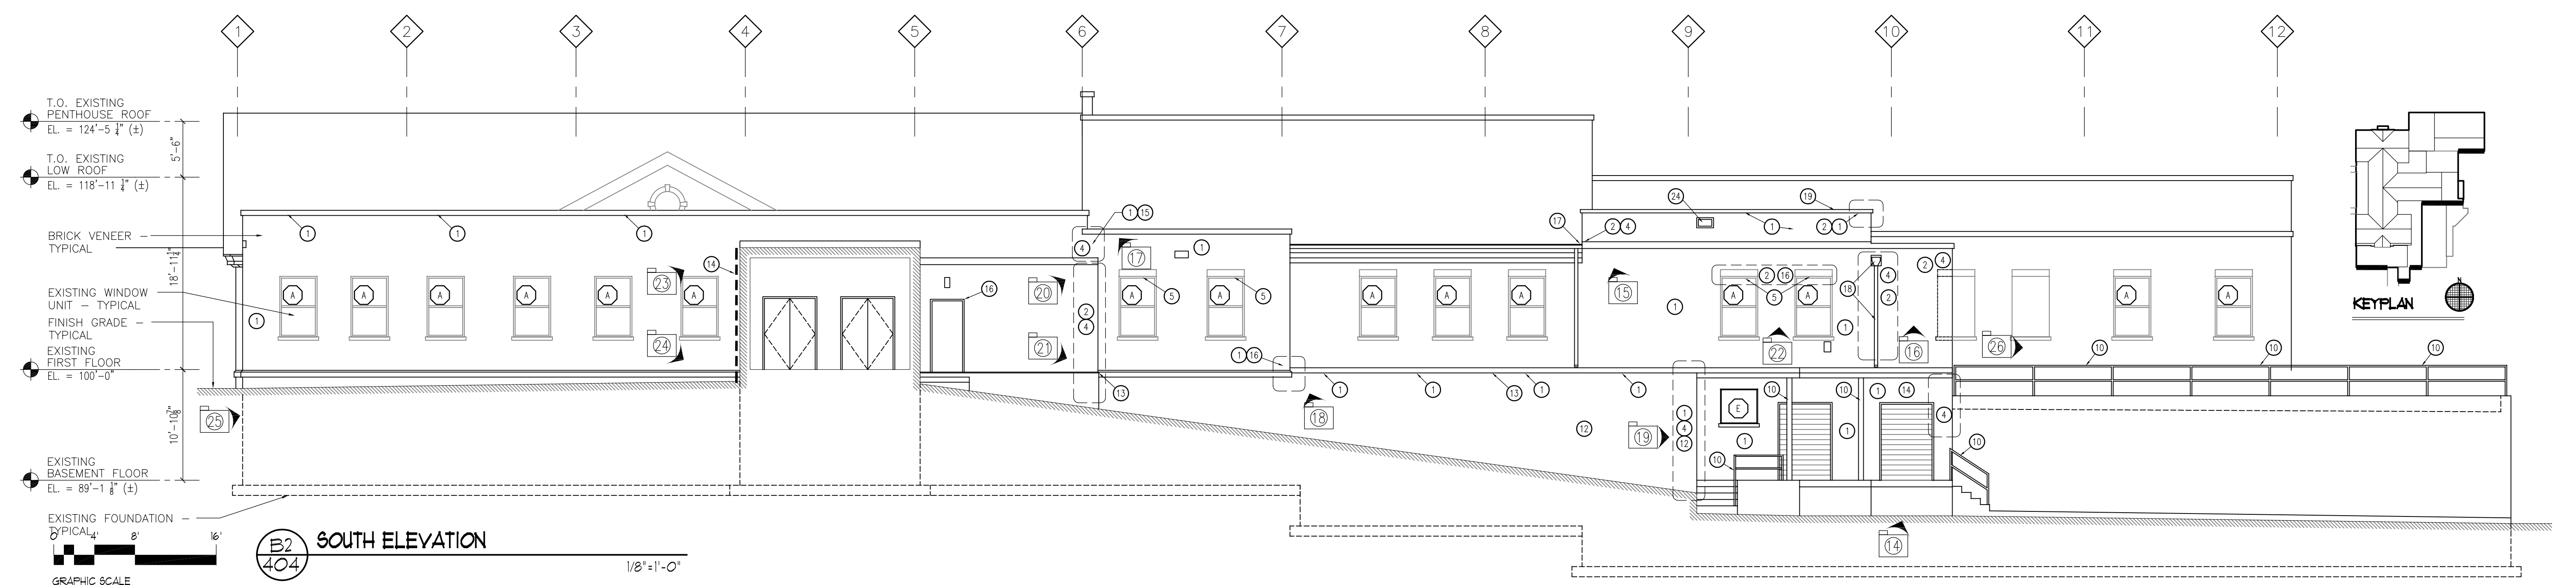

- SYMBOLS LEGEND**
- SEALANT REPLACEMENT
  - ⬆ DIRECTIONAL PHOTO REFERENCE-SEE NUMBER BELOW EACH PHOTO
  - Ⓐ WINDOW TYPE, SEE SHEET AS-890.
  - DTL SHT DETAIL REFERENCE
  - 1 KEY NOTE
  - ◇ EXISTING COLUMN LINE

- GENERAL NOTES**
- A. REFER TO SYMBOLS LEGEND, GENERAL NOTES, KEYNOTES AND DRAWINGS FOR EXTENT OF WORK.
  - B. VERIFY ALL DIMENSIONS AND CONDITIONS AT JOB SITE. PORTIONS OF EXISTING CONSTRUCTION MAY HAVE BEEN MODIFIED BY OWNER.
  - C. MAINTAIN CONTINUOUS UTILITY SERVICE TO ALL SPACES IN THE BUILDING NOT AFFECTED BY THIS WORK. COORDINATE WITH COTR ANY DISRUPTION IN SERVICES REQUIRED TO PERFORM WORK OR TO MODIFY EXISTING PIPING, DUCTWORK OR ANY ASSOCIATED EQUIPMENT.
  - D. ANY ADJACENT WORK DAMAGED DURING SEALANT OR MORTAR REMOVAL SHALL BE REMOVED COMPLETELY AND NEW MATERIALS INSTALLED AT NO COST TO THE OWNER.
  - E. CLEAN ALL SURFACES OF MASONRY WALLS AND STONE UNITS TO PROVIDE A UNIFORM CLEAN APPEARANCE.
  - F. THE ELEVATIONS AND PHOTOGRAPHS IN THESE DOCUMENTS ILLUSTRATE THE EXISTING CONDITIONS OF THE BUILDING EXTERIOR. THE NOTATIONS DO NOT LIMIT THE AREA OF WORK TO COMPLETE THE MASONRY AND STONE CLEANING, TUCKPOINTING OR REPAIR WORK.

- KEYNOTES**
- 1 REMOVE STAINS. CLEAN STONE UNITS, MASONRY UNITS AND MORTAR.
  - 2 RE-POINT MORTAR JOINTS. REMOVE LOOSE MORTAR JOINTS.
  - 3 SEAL PENETRATIONS AND OPENINGS AT EXTERIOR WALL.
  - 4 REPLACE DAMAGED/MISSING BRICKS. CLEAN SURFACE AND TUCKPOINT ADJACENT MORTAR JOINTS.
  - 5 CLEAN AND PREP RUSTED STEEL LINTEL / METAL CLADDING. PAINT LINTEL TO MATCH BRICK PAINT/METAL CLADDING TO MATCH EXISTING.
  - 6 INSPECT AREA. TUCKPOINT MORTAR JOINTS WHERE REQUIRED.
  - 7 REBUILD CORNER AND PROVIDE NEW BRICK EXPANSION JOINT (BEJ).
  - 8 ADD NEW DOWNSPOUT TO MATCH EXISTING DOWNSPOUT.
  - 9 REMOVE PEELING PAINT. CLEAN AND PREP ALL WOOD AREAS, INCLUDING BOFFITS. REPLACE ANY DETERIORATING WOOD AND REPLACE TO MATCH EXISTING. PRIME AND PAINT WOOD SURFACES TO MATCH EXISTING.
  - 10 REMOVE PEELING PAINT. CLEAN AND PREP METAL ITEMS INCLUDING METAL FACIA, STEEL RAILINGS, BEAMS, POSTS AND COLLUMS. PRIME AND PAINT TO MATCH EXISTING.
  - 11 REPAIR SPALLING CONCRETE AT STOOP.
  - 12 REMOVE VEGETATION GROWTH AND DEBRIS FROM BRICKS AND OTHER BLDG COMPONENTS. CLEAN BRICKS AND MORTAR.
  - 13 REPAIR OR REPLACE DAMAGED CONCRETE UNITS TO MATCH EXISTING. CLEAN AND REMOVE STAINS.
  - 14 REPLACE BRICK EXPANSION JOINT SEALANT. REMOVE EXISTING SEALANT, CLEAN AND PREP JOINT. PROVIDE NEW BACKER ROD AND SEALANT.
  - 15 REINSTALL AND SECURE LOOSE LIGHTNING PROTECTION CABLE.
  - 16 REMOVE AND REPLACE SEALANT JOINT. CLEAN MASONRY UNITS.
  - 17 REPAIR AND REPLACE DAMAGED ROOFING MATERIAL AND FLASHING.
  - 18 PROVIDE MISSING DOWNSPOUT. REPAIR AND CONNECT TO SCUPPER.
  - 19 REPLACE DAMAGED/MISSING COPING AND FLASHING TO MATCH EXISTING.
  - 20 REPLACE DAMAGED PLASTER / GYP. BO. BOFFIT. PATCH HOLES AND PAINT TO MATCH EXISTING.
  - 21 REPLACE DAMAGED WINDOW SCREEN.
  - 22 REMOVE EXISTING STORM SEWER SLEEVE AND CAP AS NECESSARY.
  - 23 PROVIDE AND INSTALL NEW GUTTER.
  - 24 NEW RELIEF SCUPPER.
  - 25 NEW LOUVER. REFER TO HVAC DRAWINGS.



SOUTH ELEVATION 14



SOUTH ELEVATION 15



SOUTH ELEVATION 16



SOUTH ELEVATION 17



SOUTH ELEVATION 18



SOUTH ELEVATION 19



SOUTH ELEVATION 20




SOUTH ELEVATION 21



SOUTH ELEVATION 22



SOUTH ELEVATION 23

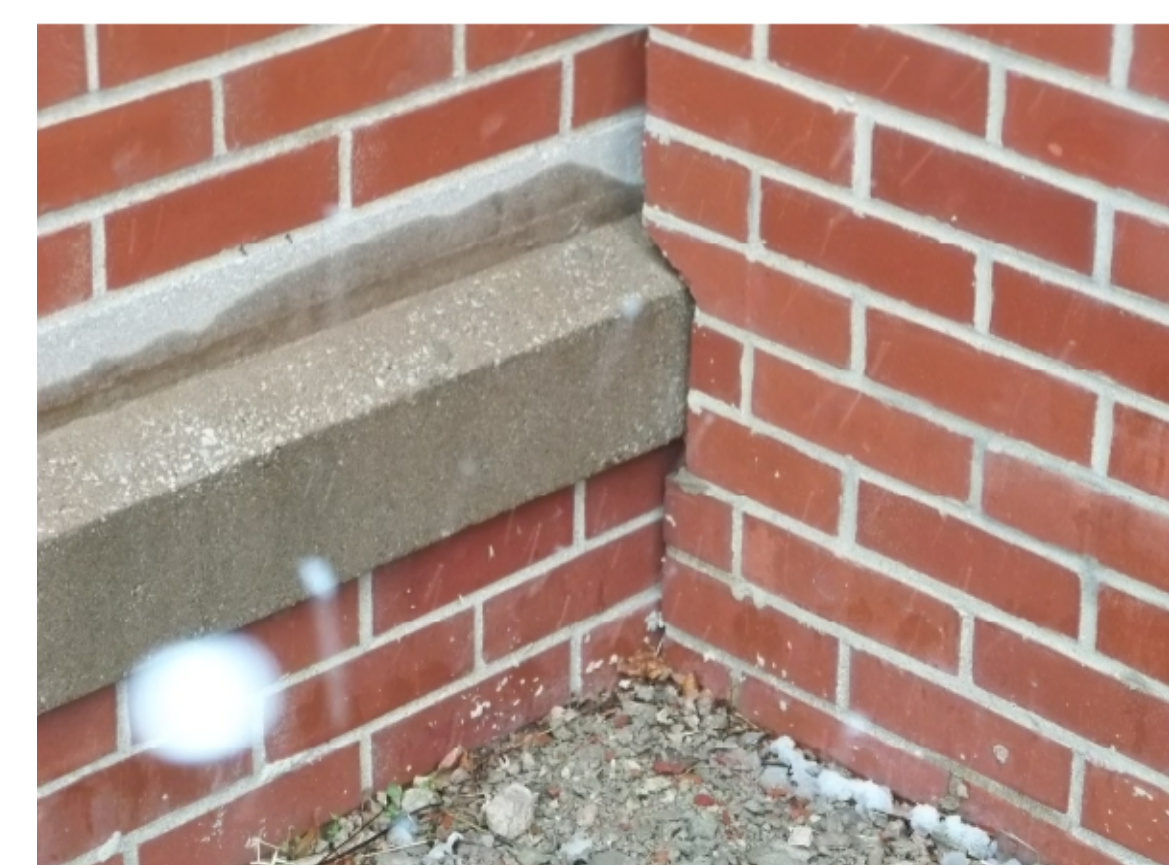

SOUTH ELEVATION 24



SOUTH ELEVATION 25



SOUTH ELEVATION 26

<p>FINAL BID DOCUMENTS</p> <p>95% CONSTRUCTION DOCUMENT SUBMISSION 12-14-12</p> <p>50% REVISED DOCUMENTS FOR REVIEW 11-26-12</p> <p>90% CONSTRUCTION DOCUMENTS SUBMISSION 05-17-12</p> <p>50% CONSTRUCTION DOCUMENTS SUBMISSION 04-06-12</p> <p>35% DOCUMENTS SUBMISSION 02-22-12</p> <p>SCHEMATIC DESIGN SUBMISSION 11-21-11</p> <p>Revisions: Date</p>	<p><b>Federal Health Care Center</b></p> <p>U.S. Department of Veterans Affairs   U.S. Department of Defense</p> <p><b>Captain James A. Lovell</b></p> <p><b>Federal Health Care Center</b></p> <p>3001 Green Bay Road</p> <p>North Chicago, IL, 60064</p>	<p><b>CAPTAIN JAMES A. LOVELL</b></p> <p><b>FEDERAL HEALTH CARE CENTER</b></p>	<p>CONSULTANTS:</p> <p><b>ARNOLD &amp; O'SHERIDAN</b></p> <p>Consulting Engineers</p> <p><b>CHEQUAMEGON BAY ENGINEERING, INC.</b></p> <p><b>MACKESEY AND ASSOCIATES, LLC</b></p>	<p>PROJECT LEADER:</p> <p><b>Plunkett Raysich Architects</b></p> <p>11000 West Park Place • Milwaukee WI 53224 • Tel 414 359-3060 • Fax 414 359-3070</p> <p><b>Intelligent Designs</b></p> <p><b>Inspired Results</b></p> <p>www.prarch.com</p> <p>PRA Job No. 110172-01</p>	<p>Drawing Title</p> <p><b>Exterior Elevations - South and Photos</b></p> <p>Approved: Project Director</p>	<p>Project Title</p> <p><b>AE SCIP for Building 6 FHCC</b></p> <p>Location</p> <p><b>North Chicago, IL</b></p> <p>Date</p> <p><b>December 14, 2012</b></p> <p>Checked By:</p> <p><b>PRA</b></p> <p>Drawn By:</p> <p><b>RLS</b></p>	<p>Project Number</p> <p><b>556-11-119</b></p> <p>Building Number</p> <p><b>6</b></p> <p>Drawing Number</p> <p><b>AS-404</b></p>	<p><b>Office of Facilities Management</b></p> <p><b>Department of Veterans Affairs</b></p>
--	--	--	--	--	---	--	--	--